

Asbestos Registry Submission Form

Facility Group:	Healthcare			
Facility Group Name:	Sun Country Regional Health Authority			
Facility Name:	Carlyle Community Health Services			
Street Address:	206 Railway Avenue East			
City:	Carlyle, SK			
Primary Contact Name:	Sam Baison	Secondary Contact Name:	John Megenbir	
Primary Contact Title:	Director - Physical Plant	Secondary Contact Title:	Maintenance Manager	
Primary Contact Email Address:	Samuel.Baison@schr.sk.ca	Secondary Contact Email Address:	John.Megenbir@schr.sk.ca	
Primary Contact Telephone:	306-842-8304	Secondary Contact Telephone:	306-842-8377	
Primary Contact Preferred Method:	Email	Secondary Contact Preferred Method:	Email	
Date Submitted:	July 19, 2017			

1. Type of Asbestos-Containing Material (ACM) (or groups of ACM)	2. Location in Facility	3. Characteristics	4. Accessibility	5. Comments (Optional)
Spray-Applied Fireproofing	Asbestos-containing spray-applied fireproofing was identified within the exterior wall cavities and the underside of roof decking throughout the South Garage portion of the facility. In addition, similar material was identified on the interior side of the perimeter metal wall cladding and the underside of the exterior roof decking in the Front Public Health Office Area.	The spray-applied fireproofing contains Crocidolite Asbestos and is considered a friable asbestos material.	Moderate / High Access is restricted to the South Garage until abatement has been completed. The material in the Public Health Office is enclosed by physical barriers.	Restricted access to the walls / ceiling space of the Public Health Office to competent persons trained in asbestos abatement techniques. Restrict all access to the South Garage.
Drywall Mud Compound	Asbestos Containing Drywall Mud Compound was identified in compilation sample taken from the main floor. Asbestos containing drywall mud compound is mostly located on joints, tape seams, and screw holes. It is advised that all drywall mud compound in the facility be considered asbestos containing until sampling proves otherwise.	Drywall Mud Compound contains 1-5% Chrysotile and is considered a friable product.	Low. The asbestos is imbedded in the mud at joints, tape seams, and screw holes.	A friable product is one that is easily crumbled by hand pressure.
Ceiling Tile	Asbestos Containing Ceiling Tile was identified in the main floor of the building. Any ceiling tile matching the tile in the main corridor should be considered asbestos containing. It is recommended that any other ceiling tile patterns in the facility be considered asbestos containing until sampling proves otherwise.	Ceiling Tile contains 1-5% Chrysotile and is considered a friable product.	Low. The asbestos is imbedded in the resin of the ceiling tile.	A friable product is one that is easily crumbled by hand pressure.